


Repairing agent for damaged bricks

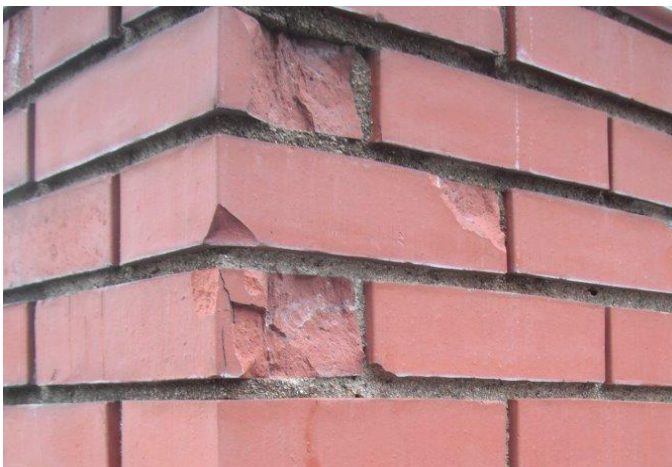

D Repairation process:

- 1 Clean up by brushing or hydrowashing the area to repair on.
- 2 Preparation of **Repi**, mixing it with water. (We advise to ask for **Repi** colour chart according with work requirements).
- 3 Product application:
 - For small repairs apply the product by spatula, palette or trowel profiling the shape.
 - For medium repairs apply previously a thin layer of Unirres, the product is white at the beginning but once it becomes translucent is ready to support the reparation mortar while it is sticky (Approx. 48hrs).
 - Finish the repation with **Repi** by spatula profiling.

For reparations with more than 3-4 cm of depth consult with our technical department at tecnico@teais.es - 981 60 21 11



For a proper refurbishment on facades made of face bricks is necessary to combine the various reparation processes of this brochure according with the type of fissure or crack being on the facade.



Teais, S.A.
Avda. da Enerxía, parcela 153
Polígono Ind. de Sabón
15143 Arteixo - A Coruña
+34 981 60 21 11
info@teais.es




REFURBISHMENT OF FACADES MADE OF FACE BRICK



PROFESSIONAL SOLUTIONS

HORIZONTAL JOINTS

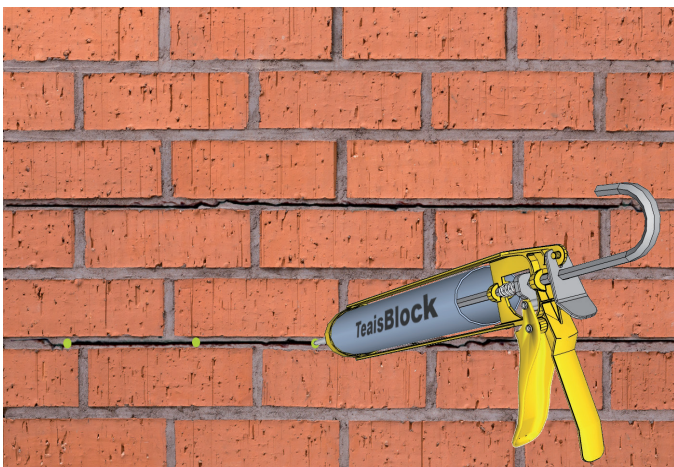


A Reparation process

- 1 Drill with bits of 10 mm. Separately each other from 100 to 150 mm.
- 2 Thoroughly clean the dust by blowing. Introduce the blower cannula until bottom and blow.



Soplante para limpieza

- 3 Apply into the holes **Teais Block**, having 2 mm of width from the external edge. Finish de process filling the bottom of the hole and fissures with **Lastois Roca**.

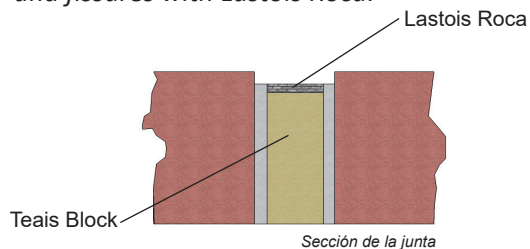


Perpendicular fissures to horizontal joints



B Repair process

- 1 A cut with a radial saw provided with a diamond disk to make a slot which allows place the staples **Teais Grap Dentada**. Cuts must be done centered into the fissure with dimensions of 180 mm length and 25 mm of depth.
- 2 Thoroughly clean the dust in the slots where the staples will be placed in using if it is necessary an air blower .

- 3 Fill the slot with the special filler adhesive **Teais fi grap**, place the pieces of **Teais Grap Dentada** and fit them with the existing joint.

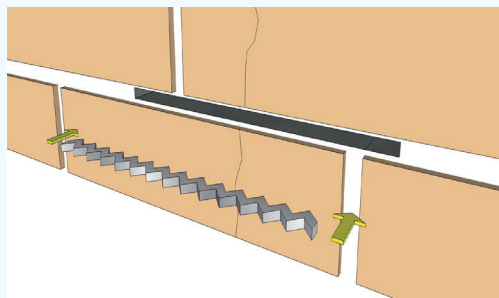


FISSURES IN BRICK



C Repair process

- 1 Clean the dust and dirty into the fissure.
- 2 Apply **Lastois Sefis** along the fissure adjusting the nozzle to the surface and slowly shifting.

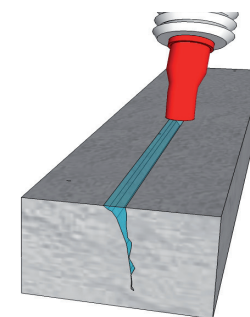

- 3 Clean with a wet sponge the excess of the product before dries.
- 4 Once it dries, apply a second hand if it is required proceeding as in the first one.